

# Application Note


## Running XP32 on a dual processor 11g blade

AN50

### Overview

Service Pack 3 for Microsoft Windows XP deploys an updated version of the Intel power management driver even if your system does not require it. This will cause the blade to bluescreen on shutdown unless the following steps are performed.

1. Click on the start menu and select “Run”
2. In the dialogue box that pops up type in “regedit” and press enter
3. In the tree view on the left expand “HKEY\_LOCAL\_MACHINE”
4. Under HKEY\_LOCAL\_MACHINE in the tree view expand “SYSTEM”
5. Then expand “ControlSet001”
6. Then expand “Services”
7. Next click on the “intelppm” node in the treeview
8. In the right hand pane of regedit double click on the “start” key
9. In the dialogue box that pops up edit the value to 4 which will prevent the service from starting
10. Click OK and close regedit
11. Reboot the blade – this reboot will fail as the new value has not yet taken effect but future reboots will work fine.

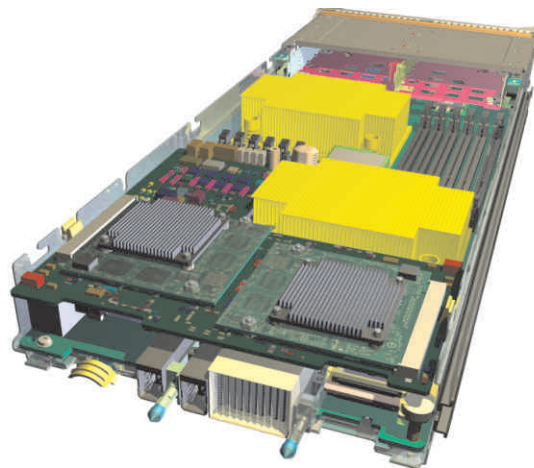

Information in this document is subject to change. No part of this document may be reproduced through any means including (but not limited to) electronic or mechanical, without express written permission from Amulet Hotkey Ltd. Amulet Hotkey Ltd may have patents, patent applications, trademarks or copyrights or other intellectual property rights covering subject matter in this document. PC-over-IP and PCoIP are registered trademarks of Teradici Corp. Other product names and company names listed within this document may be trademarks of their respective owners. © Amulet Hotkey Ltd. All rights reserved.